


Replace the following components on the servo PCB

R432 and R437 from 1R to 0R resistors (Welwyn 1% 1/16W 0603)

Change R408 47R (SMD0603 1%) to 470R (SMD0603 1%)



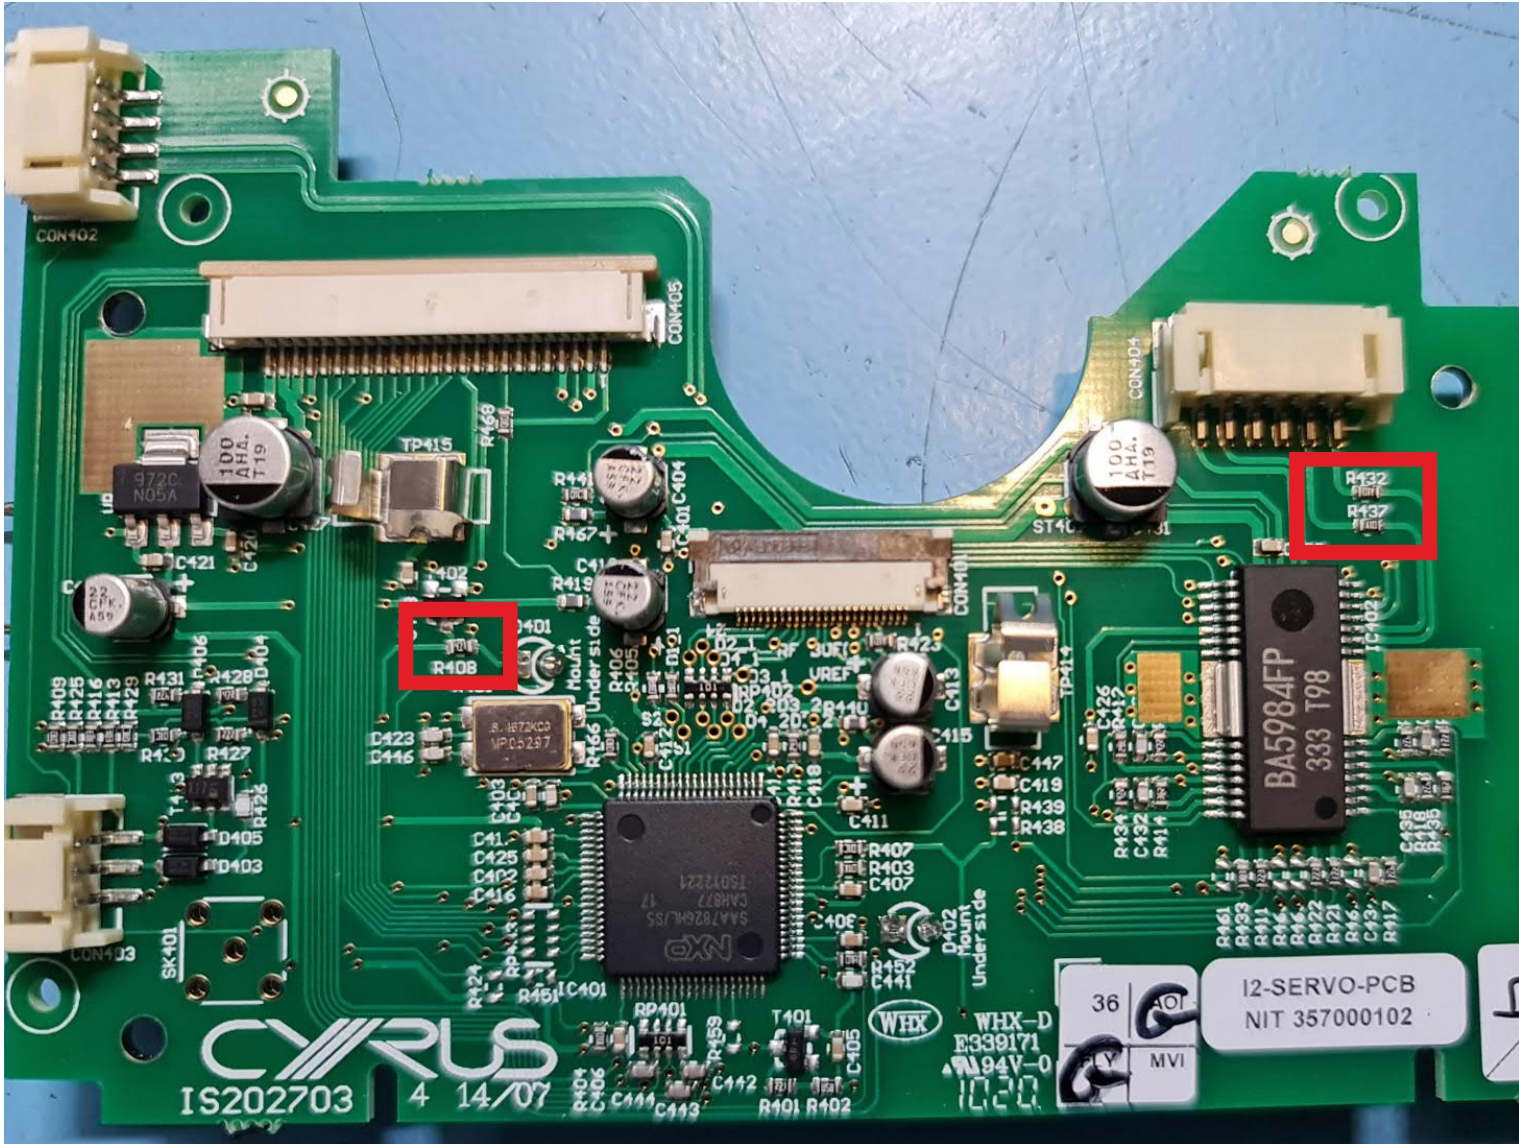

Replace D507 on main PCB for CDi/CDt/CD Xt Signature if within the following serial number range:

CDi Brushed - BN2EB4460 to BN2EB7200  
CDi Quartz - BN2EQ3325 to BN2EQ5010

CDt Brushed - BM2EB4027 to BM2EB6050  
CDt Quartz - BM2EQ3503 to BM2EQ5010

CD Xt Signature Brushed - BJ2EB4000 to BJ2EB4240  
CD Xt Signature Quartz - BJ2EQ3500 to BJ2EQ4010

D507 should be changed to the following:  
Manufacturer: TEXAS INSTRUMENTS  
Manufacturer Part No: TL432BQDBZR  
Farnell Order Code: 3124635

